Car has severe misfire.

DTCS:

P0172 System too rich Bank 1

P0174 System too lean Bank 2

Thats what happens when two upstream O2 sensors are placed in reverse order:



- 1. Car enters into the closed loop. PCM uses O2 signal for delivering the right mixture.
- 2. When PCM tries to add more fuel into bank 1, upstream sensor that is placed on bank 1 PCM sees as B2S1.
- 3. PCM thinks that bank 2 has too much gas, even though in reality its bank 1, and it tries to reduce fuel on bank 2.
- 4. B2S1 sensor, that PCM sees as B1S1, shows too much air and tries to add fuel to bank 1.

RESULT

Two upstream O2 sensors placed in reverse order.